

Page 1

Product Manual ER-1600i and ER-3200i

- 1 Introduction
- 2 Dimensions and typical applications
- Installation guidelines for EMC
- Terminal specification and block diagram
- 5 Installation and commissioning
- Customer presets and log Trouble shooting guide
- 8 Detailed specification

Please read and understand this manual prior to installing the unit. Please obtain expert help if you are not qualified to install this equipment. Make the safety of your installation a priority. This component is hazardous.

All types are of open chassis construction for use in a suitable enclosure.

IMPORTANT. To comply with CSA certification power to this unit must be supplied via a suitable CSA certified fuse or fuses, as appropriate.

Introduction. Models ER-1600i, ER-3200i

The user selects the appropriate model depending on required power output. The ER-1600i and the ER-3200i have isolated control electronics.

DRIVE TYPE	AC SUPPLY VOLTAGE	AMERICAN OPTIONS	NOMINAL OUTPUT	MAX. CURRENT	PRODUCT DISSIPATION at full current	ISOLATION
ER-1600iLV60	60/30		48/24V	16 AMPS	50 watts	ISOLATED
ER-1600i	240/110		180/90V	16 AMPS	50 watts	ISOLATED
ER-3200iLV60	60/30		48/24V	8/16/32/48 AMPS	25/50/100/150 watts	ISOLATED
ER-3200i	415/240	240/110	320/180/V(90 US)	8/16/32/48 AMPS	25/50/100/150 watts	ISOLATED

GENERAL DESCRIPTION

The units employ closed loop control of both armature current and feedback voltage to give precise control of the motor torque and speed. The motor and drive are protected by a stall timer which automatically removes power after 30 seconds if the required speed cannot be achieved. The drives will provide up to 150% of the preset maximum current for up to 30 seconds allowing high short term torques during acceleration etc. Independant control of either the current or speed loops by external inputs allows torque or speed control applications with overspeed or overcurrent protection. The demand signal may be derived from a potentiometer, 0-10V signal or 4-20mA loop. The speed feedback signal may be selected to be the ARMATURE VOLTAGE or a shaft mounted TACHOMETER.

INPUTS AND OUTPUTS

+aux input -aux input current input 4-20mA input 3 to 10V input	input current output ent input ramp output nA input demand output		+24V unregulated output +12V regulated output +10V precision reference -12V regulated output -24V unregulated output			
ADJUSTABLE PARAMETERS	Max speed Min speed	Up ramp Down ra		Max curren	t Stability	
SWITCHED FUNCTIONS	Maximum current ra Relay function	inge	Maximum Power up		Tacho feedback AV feedback	
JUMPER FUNCTIONS	Torque mode Zero reference inte	rlock	Dual suppl		Phase angle limit 50% stall threshold	

Precision tacho rectifier

 
International compatability

Dual loop control

Relay driver o/ps

MECHANICAL DIMENSIONS

Note. Dissipation in watts is approx. 2 X arm, amps




The unit should have a substantial earth connected to the heatsink earth screw provided. Employ a star washer adjacent to the heatsink for optimum earth continuity. The fixing bolts should be 5mm by 35mm for the ER-1600i and 5mm by 50mm for the ER-3200i series.


TYPICAL APPLICATIONS

BASIC CONNECTION

Page 2

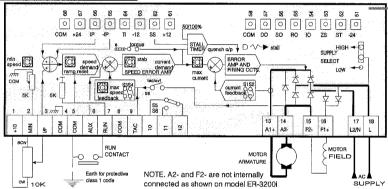

TORQUE CONTROL WITH OVERSPEED LIMITING BY SEPERATE SPEED SETPOINT.

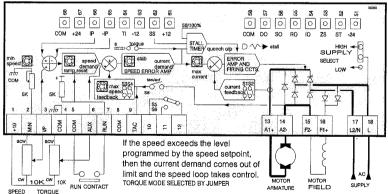



EUROTHERM LTD. DOES NOT ACCEPT ANY LABILITY WHATSOEVER FOR THE INSTALLATION, ITNESS FOR PURPOSE OR APPLICATION OF ITS PRODUCTS. IT IS THE USERS RESPONSIBILITY T ENSURE THE UNIT IS CORRECTLY USED AND NSTALLED.

HEALTH AND SAFETY AT WORK, ELECTRICAL DEVICES CONSTITUTE A SAFETY HAZARD, IT IS THE RESPONSIBILITY OF THE LISER TO ENSURE COMPLIANCE WITH ANY ACTS OR BYLAWS IN FORCE. ONLY SKILLED PERSONS HOULD INSTALL THIS FOUIPMENT

Systems inputs/outputs

Compact design

FEATURES IOC# FR101851 ISS1

PERFORMANCE

Page 4

Following the procedures outlined below will normally be required for the drive system to comply with the European regulations, some systems may require different measures, installers must have a level of technical competence to correctly install. Although the drive unit itself is not subject to the EMC directive, considerable development work has been undertaken to ensure that the noise emissions and immunity are optimised.

* EN61800-3 specifies 2 alternative operating environments. These are the domestic (1st environment) and industrial (2nd environment). There are no limits specified for conducted or radiated emissions in the industrial environment, hence it is usual for the filter to be omitted in industrial systems.

Definition of an industrial environment. All establishments other than those directly connected to a low-voltage power supply network which supplies buildings used for domestic purposes.

DRIVE INSTALLATION REQUIREMENTS FOR EMC COMPLIANCE

Keep parallel runs of power and control cables at least 0.3m apart. Crossovers must be at right angles

Keep sensitive components at least 0.3m from the drive and power supply cables

The AC connections from the filter to the drive must be less than 0.3m or if longer, correctly screened


Do not run filtered and unfiltered AC supply cables together

Control signals must be filtered or suppressed eg _ control relay coils and current carrying contacts. The drive module has built in filters on signal outputs

The AC supply filter must have a good earth connection to the enclosure back plane. Take care with painted metal to ensure good conductivity.

The metal enclosure will be the RF ground. The AC filter, drive earth and motor cable screen should connect directly to the metal of the cabinet for best performance

The AC input filter has earth leakage currents, Earth RCD devices may need to be set at 5% of rated current

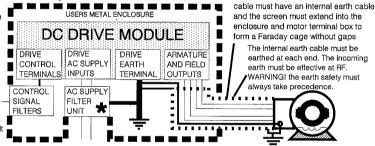



IMPORTANT SAFETY WARNINGS

The AC supply filters must not be used on supplies that are un-balanced or float with respect to earth The drive and AC filter must only be used with a permanent earth connection. No plugs/sockets are allowed in the AC supply

The AC supply filter contains high voltage capacitors and should not be touched for a period of 20 seconds after the removal of the AC supply

MOTOR :

Linear control signal cables must be

screened with the screen earthed at

length of screen stripped back and

armoured with 360 degree screen


connect it to an analogue earth point


The motor cable must be screened or

terminations to earth at each end. The

the drive end only. Minimise the

MULTIPLE DRIVES WITH ONE FILTER The filter should be rated for the worst case total

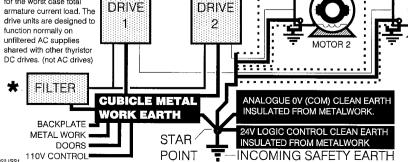

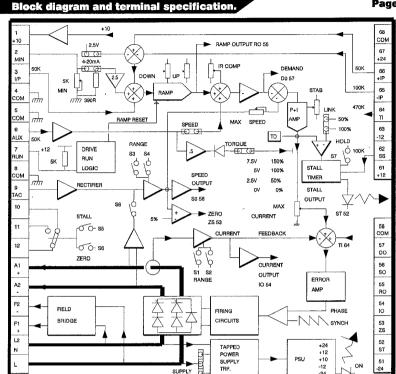

SELECT

1 +10V PRECISION REFERENCE 10mA MAX, SHORT CCT, PROOF

2 MINIMUM END OF SETPOINT POT OR 4-20 mA CURRENT LOOP I/P

3 SPEED DEMAND INPUT 0-10V FOR 0-100% SPEED

4 COMMON, (4-20mA BETURN

5 COMMON, (connect to earth for protective class 1)

6 AUXILIARY INPUT. ON BOARD JUMPER SELECTS DIRECT SPEED OR TORQUE MODE. 0-10V FOR 0-100% CONTROL

7 CONNECT TO COMMON TO BUIN 60mS ON / 20mS OFF (WARNING, RUN is an electronic inhibit function. The field remains energised, and all nower terminals remain 'live' RUN must not be relied upon during hazardous operations)

8 COMMON (internally connected to T4, T5, T58, T68)

9 TACHO INPUT 25-400V FULL SCALE. + OR - POLARITY 10 RELAY CONTACT NC | RELAY CONTACT RATING 1 AMP 240V AC

RATINGS ACCORDING TO CSA 11 RELAY CONTACT NO VOLTAGE RATING OF RELAY TERMINALS 10/11/12 MUST NOT EXCEED 30V AC OR 42.4V DC.

12 RELAY POLE

A1+ ARMATURE OUTPUT A2 -ARMATURE OUTPUT

THE ER32001 HAS TWO 2A FUSES WHICH PROTECT THE FIELD F2- FIELD OUTPUT AND POWER SUPPLY TRANSFORMER ONLY, FOR A HALF WAVE FIFLD VOLTAGE CONNECT FIFLD TO F2- AND L2M. THIS WILL F1+ FIELD OUTPUT GIVE AN OUTPUT OF 0.45 TIMES THE AC SUPPLY

L2/N AC SUPPLY INPUT ACCORDING TO SUPPLY SELECT JUMPER

AC SUPPLY INPUT ACCORDING TO SUPPLY SELECT JUMPER

68 DRIVE COMMON

SIGNAL PADS ON TOP EDGE (TERMINAL COMPATIBLE)

67 +24V OUTPUT 25mA MAXIMUM DO NOT SHORT

66 AUXILIARY SPEED INPUT 0 TO 10V FOR 0-100% RAMPED SPEED

65 AUX. INVERTING SPEED INPUT 0 TO -10V FOR 0-100% RAMPED SPEED

64 INPUT TO CURRENT LOOP, 0-5V FOR 0-100% CURRENT

63 -12V OUTPUT 10mA MAX, DO NOT SHORT.

62 STOP/START INPUT. CLOSE TO -12V TO ACTIVATE STALL CONDITION. CLOSE TO ±12V TO RELEASE STALL CONDITION.

61 +12V OUTPUT 10mA MAX. DO NOT SHORT.

58 DRIVE COMMON

57 SPEED DEMAND O/P 0 TO -10V REPRESENTS 0-100% DEMAND. OUTPUT IMPEDANCE 1K OHMS

56 SPEED OUTPUT, TYPICALLY 7.5V FULL SCALE. ADJUSTMENT OF MAX SPEED PRESET WILL ALTER THE FULL SCALE READING FROM 4V (ACW)

55 SETPOINT RAMP OUTPUT 0-10V. IMPEDANCE 1K OHMS

54 CURRENT OUTPUT 0-5V FOR 0-100% OF CHOSEN RANGE (S1, S2). 1K IMPEDANCE interna transistor

53 ZERO SPEED RELAY DRIVER O/P MAX 100mA 52 STALL RELAY DRIVER O/P MAX 100mA

Switches to -24V 51 -24V RELAY SUPPLY 25mA DO NOT SHORT

T52 or T53 External Relay coil. 2K8 Ohms FROM T51

R101852 ISS1

POWER CABLING

Use correctly rated cable minimum 600V AC 2 times armature current

Ensure supply is disconnected before working on unit

FUSING

The drives MUST BE FUSED EXTERNALLY with semiconductor fuses. The fuses must be rated at 1.75. times armature current and have an I2t rating lower than the value listed in the specification page 8. Any warranty will be invalid if the fusing is incorrect.

CONTROL SIGNALS

The ER-1600i and ER-3200i have isolated control terminals, and may be connected to other systems. Avoid running signal cables close to power cables.

SUPPRESSION

The drives have excellent noise immunity. However installations involving electrical welding or RF induction heating may require further filters on the line and armature terminals. Contactor coils and sparking contacts may also require suppression. A 100R in series with 0.1uF cap. is usually adequate in these situations. Refer to page 3 for EMC guidelines.

PRESETS, SWITCHES, JUMPERS

Always use the correct insulated adjustment tools. Do not touch. Electric shock hazard exists!

Optimise heatsink airflow. Avoid vibration and ambient temps outside -10C and +40C. Protect the drive from pollutants.

MOTOR

Foot mounted motors must be level and secure. Protect motors from ingress of foreign matter during installation. Ensure accurate alignment of motor shaft with couplings. Do not hammer pulleys or couplings onto the motor shaft. Before running the motor complete the following check list.

- 1) Correct insulation resistance between all windings and earth with all drive cables disconnected
- 2) Check inside connection box for foreign objects, damaged terminals etc.
- 3) Check that brushes are in good condition, correctly seated and free to move in brush boxes. Check correct action of brush springs.
- 4) Motor vents must be freed of any obstruction or protective covers prior to running.
- 5) WARNING reversing systems. Do not transpose the armature connections until the motor has stopped. Failure to heed this warning will cause damage.

SUPPLY

Please ensure that the supply selection jumper on the drive matches the incoming supply. Failure to do this may result in permanent damage to the drive unit and will invalidate any warranty.

INITIAL SETTINGS

The drive units are shipped to run on the highest supply option at nominal speed, in ARMATURE VOLTAGE feedback mode, in the lowest current range. To change this run through switches S1 to S8 and select accordingly.

S1 S2	Set switches to give desired current range
S3 S4	SPEED. Calculate desired full scale feedback voltage and select range. Adjust within the range by using the MAX SPEED preset. Feedback may be tacho OR armature.
S5 S6	Select according to desired relay function

S7 Normally OFF. When on, the power up inhibit function will operate. Reset with T62.

ON for Armature voltage feedback, OFF for Tacho feedback.

PRESET POT SETTINGS

S8

MAX CURRENT, cw rotation gives 0 to 100% current limit, eq. 50% rotation gives 50% current limit. Check motor rating plate to find correct limit. (S1 S2 can provide 4 current ranges)

Anticlockwise	MIN SPEED UP RAMP	DOWN RAMF IR COMP
Midway	STAB	

POWER ON Check ON lamp lights

CLOSE RUN CONTACT (see note opposite) Gradually increase external setpoint, check motor rotation. If the direction is wrong, TURN OFF and swap A+, A-

INCREASE SETPOINT.

Drive should ramp up to full speed. Fine adjust with MAX SPEED preset. Do not exceed armature voltage rating. Reduce setpoint, drive should ramp down to zero. Adjust MIN SPEED to desired level. Run motor up and down and adjust RAMPS.

STABILITY

Adjust STAB to improve response if necessary. Clockwise rotation gives faster response. Excessive rotation in either direction may lead to instability depending on load.

IR COMP

Speed droop may occur where armature voltage feedback is used. This is compensated for by clockwise rotation of IR COMP preset. Excessive rotation may lead to instability. No IR COMP is required for systems with tacho feedback.

TORQUE SYSTEMS

See typical applications. In this mode the lowest setpoint has priority. Hence the speed setpoint is set to demand a speed slightly in excess of the working speed, and then the torque setpoint will always be operating as a limit. In the event of a web break for example, the motor will only run up to the level set on the speed pot.

LAMPS

On indicates AC power is applied

STALL Stall lamp lights and drive guenches if stall timer trips, see below for description of timer characteristics.

PRESETS

Rotate clockwise to increase speed. Change SPEED range with S3 and S4

Rotate clockwise to increase minimum SPEED speed. Use to adjust 4-20mA loop burden resistor between 0 and 390R if 4-20mA mode is selected

Rotate clockwise to increase drive RAMP acceleration. Span 1 to 30 seconds DOWN Rotate clockwise to increase drive deceleration, Span 1 to 30 seconds, Note, natural coast down is a limit.

Rotate clockwise to increase response. STAB Excessive rotation may cause instability. If rated motor voltage is much lower than AC supply then anticlockwise is prefered.

Rotate clockwise to increase level of armature voltage droop compensation. Excessive rotation may cause instability. Always set fully anticlockwise with tacho.

Rotate clockwise to increase current. Use S1


CURRENT and S2 to select range





Midway

Clockwise

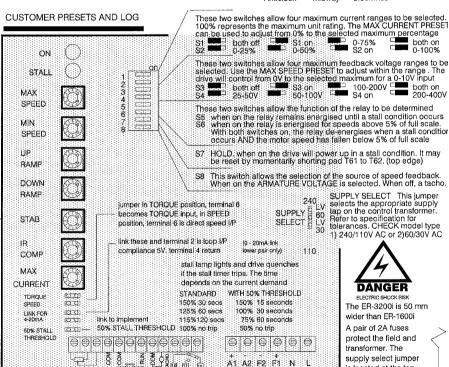

A1+

CAUTION For frequent stopping or jogging it is not good practice to rely on switching the supply off and on to stop and start with the run contact permanently closed. This may result in an uncontrolled current pulse for one half mains cycle under certain conditions. Eg main contact bounce. This could lead to undesired motor movement or device damage. Use a spare NO contact on the main supply contactor in series with T7 and any other RUN contacts in rapid start stop systems

L2/N 415 240 L F2- F1+ A2-AC supply voltage legend,

selector marked HIGH/LOW

is located at the top


right edge (HIGH/LOW)

ER101853 ISS1

TROUBLE SHOOTING. Page 7

The drive consists of 2 high accuracy feedback control loops. 0 to +10V FIRING AND output on 55 AMPLIFIER ERROR AMP. BRIDGE 0 to 10V. output current output phase CIRCUITS speed demand demand angle demand Ф мотоп The outer speed TALL TIMER CURRENT AM output on 56 timing active output on 54 (volts) loop controls 0 to 7.5V typ. while demand 0 to +5V for the inner torque >105%, 30secs 0 to full range (current) loop

- STALL problems shown by stall lamp coming on after running are caused by the drive unit not able to give set speed
- Typical STALL reasons. a) MAX CURRENT preset not correctly set, hence insufficient torque
- b) Motor not powerful enough for application Speed calibration set beyond capability of supply.
- c) Any factor which prevents motor from rotating at set speed. eg, lammed load, low supply voltage:

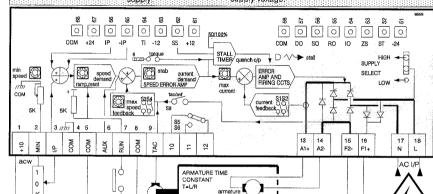

no field on

PM motors

3 Pot wired with T2 and T1 6 Loose or intermittent transposed. Motor slows down instead of speeding up

Close

cw

Setpoint

(1 to 10K)

- 4 Pot wired with T2 and T3 7 transposed. Motor slows down for clockwise rotation. T1 may be shorted to T2.
- 5 Pot wired with T1 and T3 8 transposed. Motor slows down for anti-clockwise rotation. T1 becomes shorted to T2.
- tacho coupling causes Make sure coupling is secure and non-elastic

(optional)

- Incorrect feedback scaling causes over or underspeeding. Calculate power device failure. the desired max, tacho volts, adjust S3, S4
- Tacho failure. Until a 11 Brushes should be in replacement is obtained change to AV feedback S8. Rescale with S3, S4
- 9 Armature resistance should normally be a instability or overspeeding. few ohms. The armature time constant must be greater than 10msecs
 - 10 Shorted turn on motor armature can cause Check resistance through 360 deg rotation
 - good condition, correctly seated, and free to move in brush boxes.
- 12 Field resistance should normally be a few hundred ohms. The field must be isolated from earth and the armature

DANGER

ELECTRIC SHOCK RISK

For half wave field output connect

field to F- and N. Field volts = 0.45 times AC supply

- 13 Do not open circuit the field. Do not open circuit the armature unless RUN is opened
- 14 The AC supply must lie within the limits specified on page 8. Ensure the selection iumper is correct.

FR101854 ISS1

Page 8 **SPECIFICATION**

FUNCTION	SPECIFICATION					COMMENTS	
CONTROL ACTION	DUA	L LOOP PI	ROPORTIO	NAL + INTE	GRAL		
FEEDBACK METHOD 0-100% REGULATION MAX TORQUE SPEED RANGE OVERLOAD	2% TYPICAL 0.1% TY			CHOMETER % TYPICAL 100 : 1 ds.	SWITCH SELECT BEWARE MOTOR HEAT AT LOW SPEED		
QUIDTOMED DEFORTS		130% CONTINUED CONTILITY FOR					
CUSTOMER PRESETS MAX SPEED MIN SPEED UP/DOWN RAMPS STABILITY IR COMPENSATION MAX CURRENT	25V - 400V FULL SCALE FEEDBACK 0-30% OF MAX SPEED INDEPENDANTLY ADJUSTABLE 1-30secs VARIES SPEED LOOP GAIN 0-30% OF ARMATURE VOLTAGE LINEAR SETTING FROM 0-100%, 4 SWITCHED RANGES					SWITCH SELECT NON-INTERACTIVE LINEAR RAMPS DO NOT USE WITH TACHO 150% OVERLOAD	
SWITCH SELECTABLE							
CURRENT RANGE SPEED RANGE RELAY FUNCTION POWER UP HOLD TACHO/AVF	FOUR RANGES OF ARMATURE CURRENT FOUR RANGES OF FEEDBACK VOLTAGE DRIVE STALL OR ZERO SPEED RELAY POWER UP IN STALL OR RUN MODE SELECT TACHO OR ARMATURE VOLTAGE FEEDBACK				\$1, \$2 \$3, \$4 \$5, \$6 \$7 \$8		
JUMPER FUNCTIONS TORQUE MODE SUPPLY SELECT	O-10V INPUT FOR 0-100% CURRENT WITH AUTOMATIC OVERSPEED PROTECTION. DUAL SUPPLY VOLTAGE SELECTOR					JUMPER SELECTED	
LINK FUNCTIONS 4-20mA OR 0 -20mA LOOP 50% STALL LEVEL	ALLOWS CURRENT LOOP SIGNAL INPUT FOR SPEED ALLOWS LARGE PEAK CURRENTS					5V COMPLIANCE 150% PEAK	
SUPPLY RANGES 45HZ TO 65HZ AUTO RANGING	MAX MIN	LV30 36V 27V	1V60 72V 54V	110 130V 100V	240 264V 200V	415 440V 360V	OVER FULL TEMP RANGE WITH OUTPUTS LOADED
AC POWER UP RESET RUN LINE	MINIMUM OFF TIME BEFORE RE-SUPPLY 60mS ON, 20mS OFF. ALWAYS USE A RUN CONTACT TO ENABLE THE DRIVE AFTER THE APPLICATION OF AC				500mS		
SIGNAL OUTPUTS	SPEE	D, CURRE	NT, RAMP	DEMAND			ALL BUFFERED
SIGNAL INPUTS	3 SPEED INPUTS -/+ RAMPED, DIRECT, ALL SUMMING					PROTECTED	
RELAY OUTPUTS	STALL OR ZERO SPEED RELAY					VOLT FREE CHANGEOVER	
RELAY DRIVERS	STALL, ZERO SPEED OPEN COLLECTOR PNP					FOR -24V DC 100mA MAX	
RAIL OUTPUTS	-24V UNREGULATED 25mA +12V, +10V, -12V REGULATED 10mA					+/- 20% 0.01%/DEG C 5%	
FIELD OUTPUT	0.9(0.45) TIMES AC SUPPLY. ER-1600i 1Amp, ER-3200i 2Amp					FULL(0.9) or HALF WAVE(0.45)	
ALTITUDE	3000 METRES MAX FOR FULL RATING					DERATE 1%/100M	
HUMIDITY FORM FACTOR	85% R.H AT 40 C, NON-CONDENSING TYPICAL 1.5 AT MAX. OUTPUT						
TEMPERATURE ARMATURE TIME CONSTANT	STORAGE AND OPERATING -10 to +50C MINIMUM 10mS. USE EXTRA ARMATURE CHOKE TO INCREASE T					T = INDUCTANCE/RESISTANCE	
MAX Ñ FUSING (Amps Seconds) ER-1600i =365, ER-3200i 8/16/32 =570, ER-3200i 48 =4750				SEMICONDUCTOR FUSES REFER TO SUPPLIER			



www.eurotherm.co.uk